



Models Impacted by GPS Rollover Cycles - Core & Serial Number (S/N) DETAIL

Rollover Dates:	Dec. 20, 2020	SERIAL NUMBERS /Affected Core	June 20, 2021	Affected Core & SERIAL NUMBERS	Jan. 2, 2022 (JRC May 15, '22)	Affected Core & SERIAL NUMBERS	Update / Replace
Furuno	Felcom 15/16 w/ GPS GN79L5A	S/N Before 3533-9371; Software Update 3.11 or 5.05			Felcom 15	GPS GN-8097 B/C/D; S/N 3533-9471 & After	Software Update v3.11 <u>may</u> Fix or replace w/ FELCOM 18/19
	Felcom 16 w/ GPS GN79L5A	S/N Before 3534-2756; Software Update 3.11 or 5.05			Felcom 16	GPS GN-8097 B/C/D; S/N 3534-2756 & After	Software Update v5.05 <u>may</u> Fix or replace w/ FELCOM 18/19
					Felcom 18/19 (older Units)	GN-8097 B/C/D; Fel18 S/N 4507-4045 & prior; Fel19 S/N 3599-2507 & prior	REQUIRES Software Update v1.20
	AIS FA100	GN79, ALL					Replace with FA170
					AIS FA150	GN-8093 D/E/F/G/H	Update transponder software 4.07 to prevent or NEW FA170
					AIS ClassB FA50	GN-8093 - ALL S/N	Update processor software v2.02
			GP32 & GP37 GPS	GN-8091	GP32 & GP37 GPS	GN-8093 Core: GP32 S/N 4439-1804 & above; GP37 S/N 4441-3006 & above	Replace with GP33 or GP39
					GP33	GN-8093 D/E/F/G/H Core S/N EARLIER than 6412-8195	Update Software to v2.04 or Higher
	GPS GP310B w/ Core GN-79L2B-P	Replace S/N before 3453-5687 ; S/N Prior 3453-5687 Cold Start					Cold Start Potential or Replace w/ GP330B
			GPS GP320B	GN-8092C ; S/N 3473-6767 + prior	GPS GP320B	GH-8299 Core; ALL S/N	Replace with GP330B
				GP330B	S/N Earlier than 4457-7001	Replace with Furuno 220WX	
				WS200		Replace with Furuno 220WX	
				GP500MK2	ALL Core & S/N	Replace with GP33 or GP39	
Furuno			GP80 and GP90/Dual GPS	GN-8091C/D, Replace Core with P/N 000-150-957	GP80 and GP90/Dual GPS	GN-8096C / GN-097 C/D	Replace with GP170 or GP170D
			GP150 & GP150D	GN-8091C/D Update software to v4.025	GP150/Dual	ALL	Update Software to v4.05 OR Replace with GP170 or GP170D
			GPS GP1640/F, GP1650, GP1850	GN-8091C/D	GP1650 & GP1850 (W/WD/WDF/WF) & GP7000/F	GN-8091 Core; All S/N	REPLACE w GP1871F or GP1971F GPS/ Plotter /Sounder / Fishfinder
			GP3500 & GP3500F	GN-8091C/D and GN-8092C	GP3500 and GP3500F	GN-8096 Core; All S/N	Update Software to v6.03 Sounder / Chartplotter /GPS
					SC30 SatCompass	GN-8093 D/E/F/G/H Core	Update Software to v3.03
					SC50 SatCompass	GN-8094 D/E/F/G Core ALL S/N	Update Processor Software to v2.02
					SC110 SatCompass		Update Software to v3.03
					GS100 - SAT Speed Log		Software 1.11
	Cobham Satcom	SAILOR 65xx GNSS/DGNSS					Software 2.03 & APP
		SAILOR 6004 Control Panel					
JRC					JRC May 15, '22	Affected Core & S/N	Update / Replace
					Inm. C JUE-85	GR10251 to GR23738	Upgrade Software Version 1.00, 2.00 or 3.00
					Mini-C JUE-95 SA	GR10051 to GR23188	Upgrade Software V 1.0 or 3.0
					Mini-C JUE-95 LT	GR11703 to GR23598	Upgrade software V 2.0 or 3.0
					Mini-C JUE-95 VM	GR10001 to GR23593	Upgrade Software V 1.0 or 3.0
					FBB JUE-250	ALL	FBB JUE-251 or Software Upgrade
					GPS Navigator JLR-7700 MKII	After KE47190	Replace with JLR-7600 or JLR-7900, Or Adjust Date-Time via
					GPS Rec. JLR-4300	After KE54239	Setting Methods for JLR-7700MkII, JLR-4330 /4331
				GPS Rec. JLR-4331	After KE50479		